

Remove the windscreen washer pump(4) .

REFITTING

1. REFITTING OPERATION

Refit the windscreen washer pump to the bottle.

Connect:

-
- the rear jet supply pipe,
- the front jet supply pipe,
- the windscreen washer pump connector.

2. FINAL OPERATION

Proceed in the reverse order to removal.

Fill-up the windscreen washer bottle.



Repair-80x04x06x02-01x37-1-27-1.xml



SCUTTLE PANEL GRILLE: REMOVAL - REFITTING



parts always to be replaced:

[clip under scuttle panel grille](#)


REMOVAL

1. REMOVAL PREPARATION OPERATION




Remove the windscreen wiper arms [Wiping and washing: List and location of components](#) .


mcx30.com

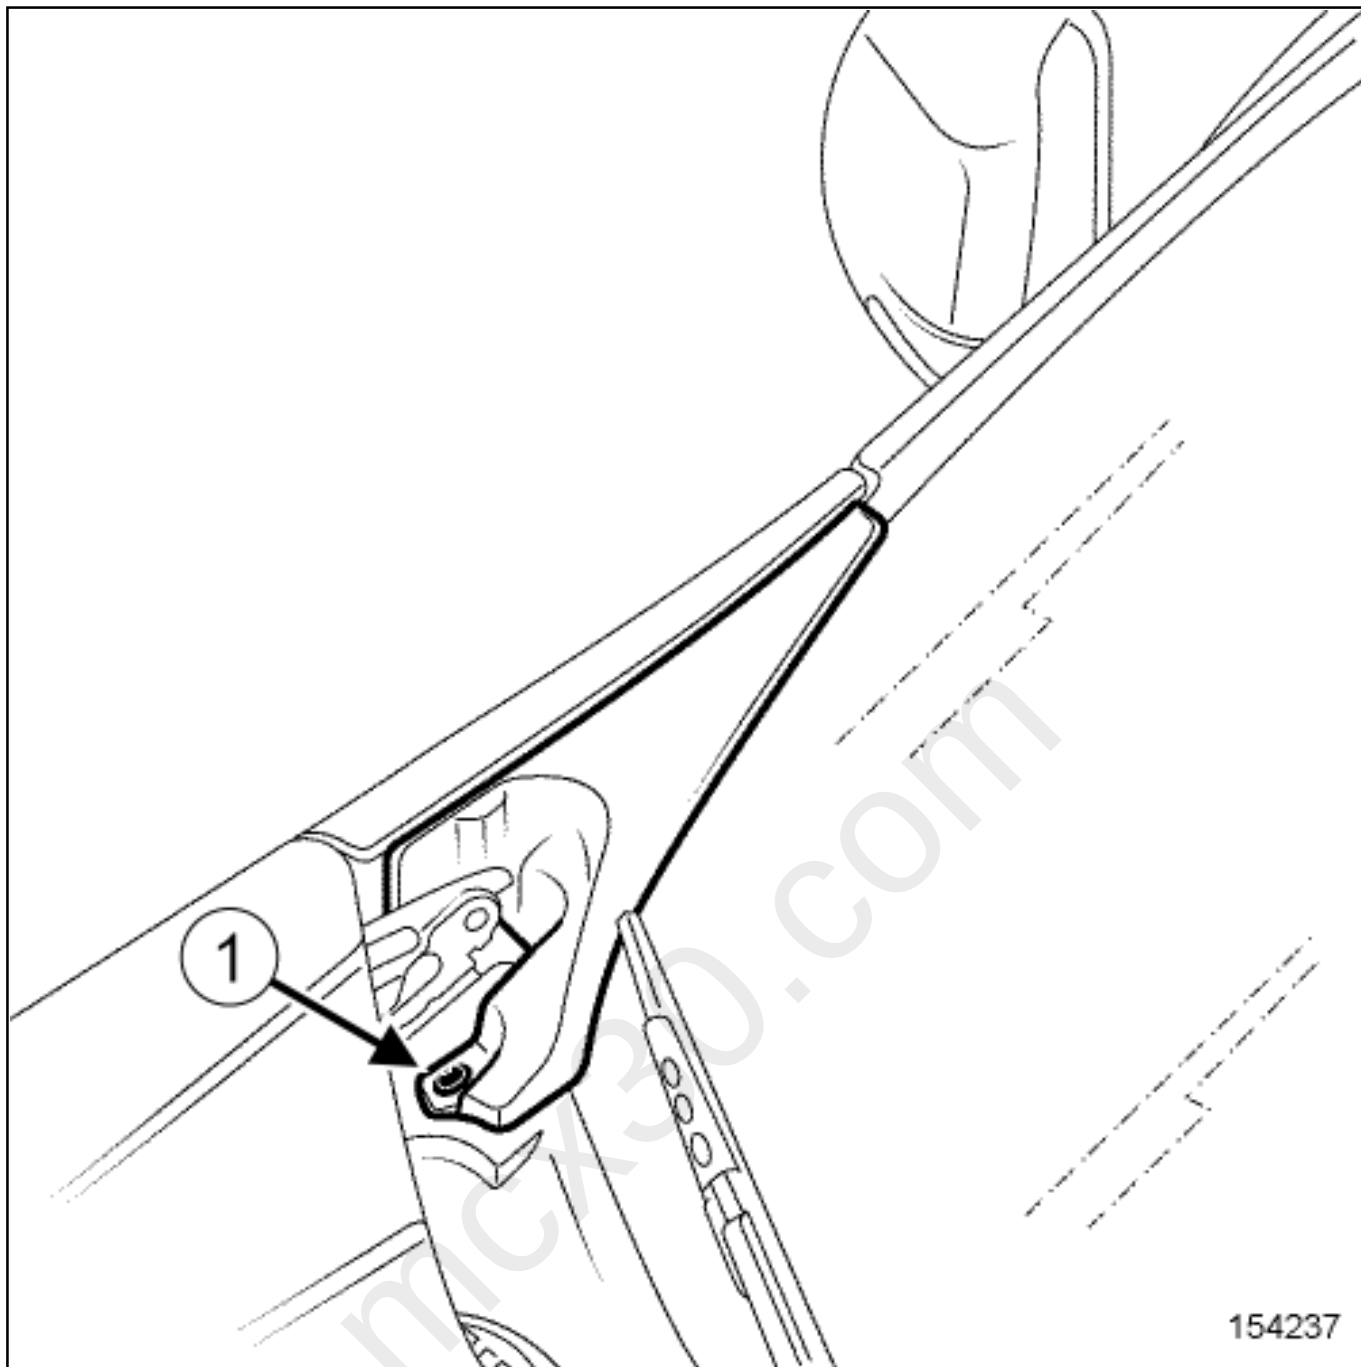

Remove the windscreen lower side trim screw(1) .

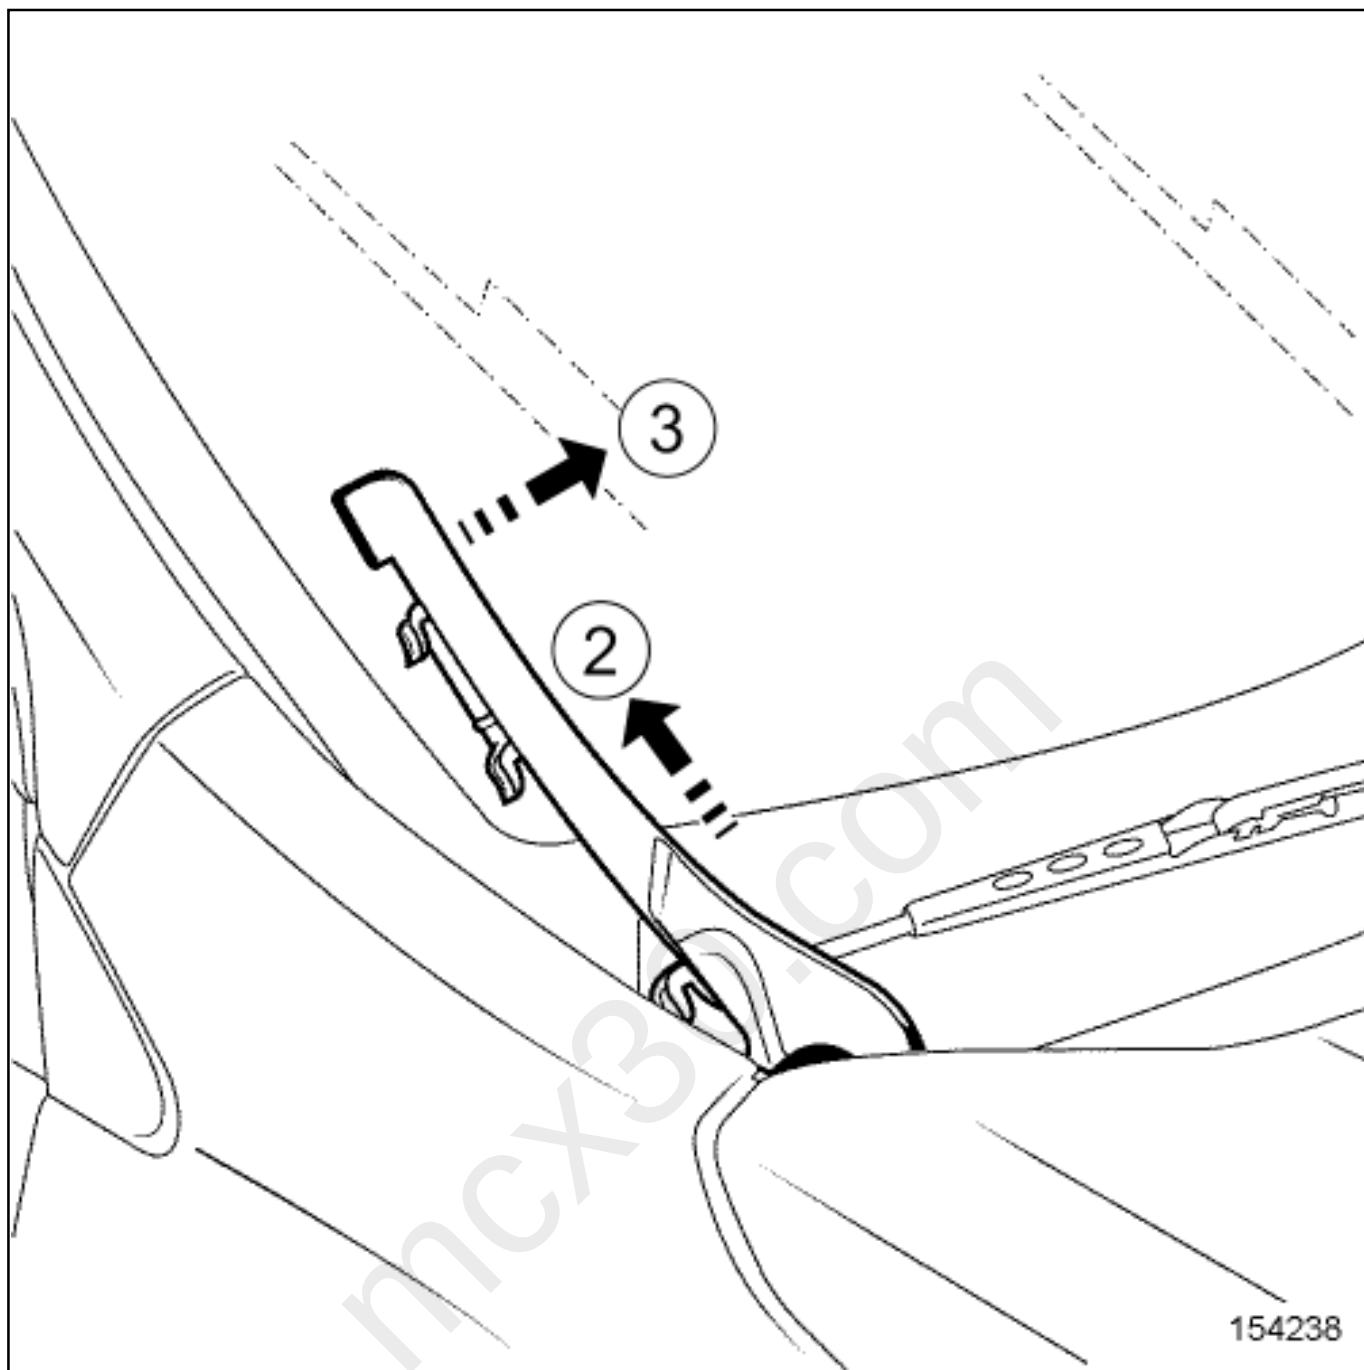


Remove the windscreen lower side trim by sliding at(2) and pulling at(3) .

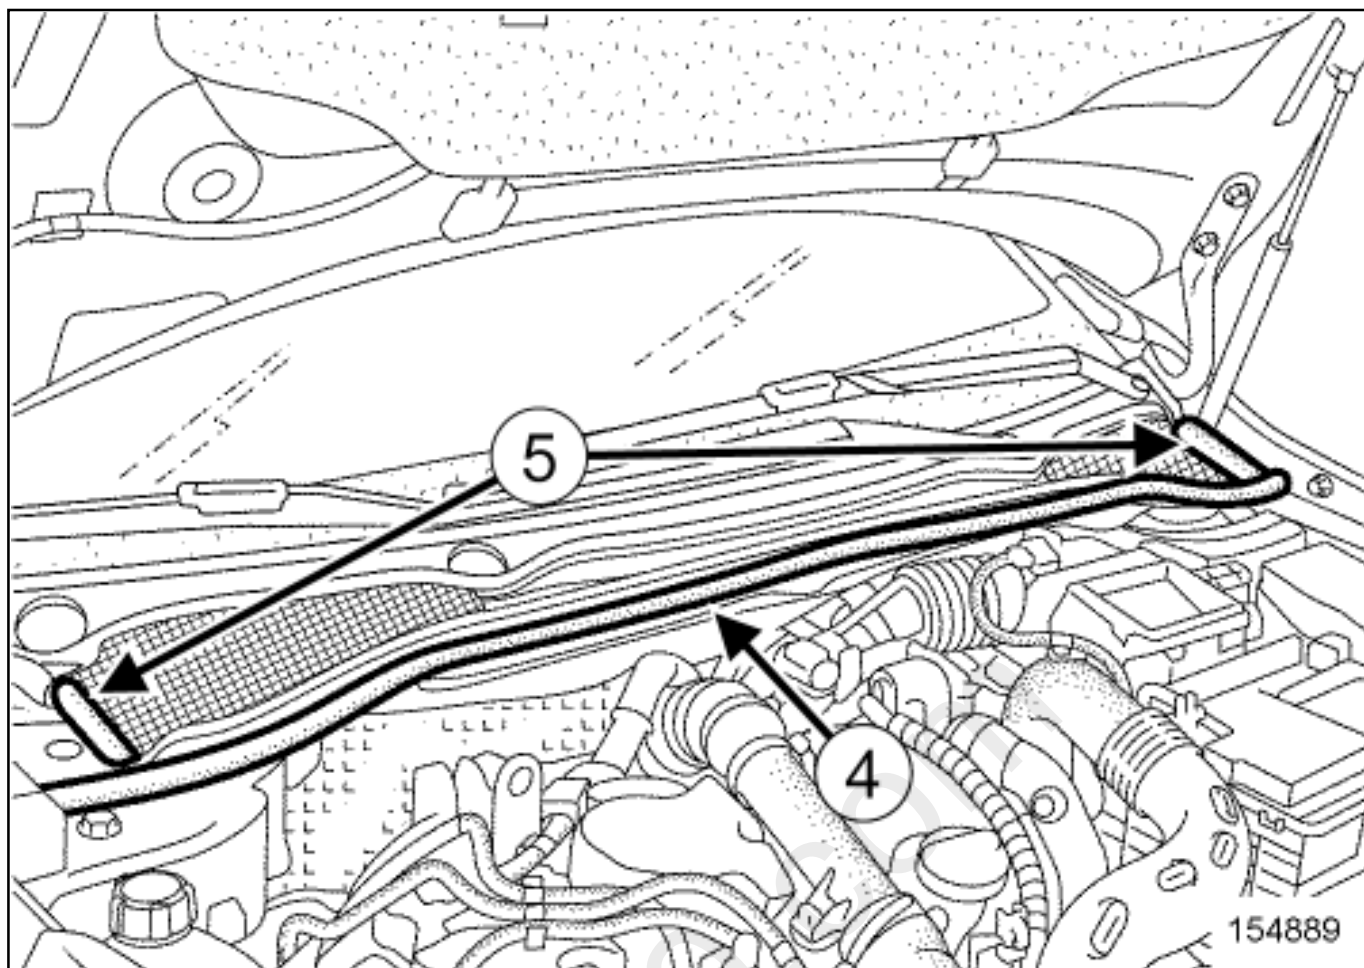

Remove:

- the engine compartment seal(4) ,
- the side sections of the scuttle panel grille(5) .

2. REMOVAL OPERATION

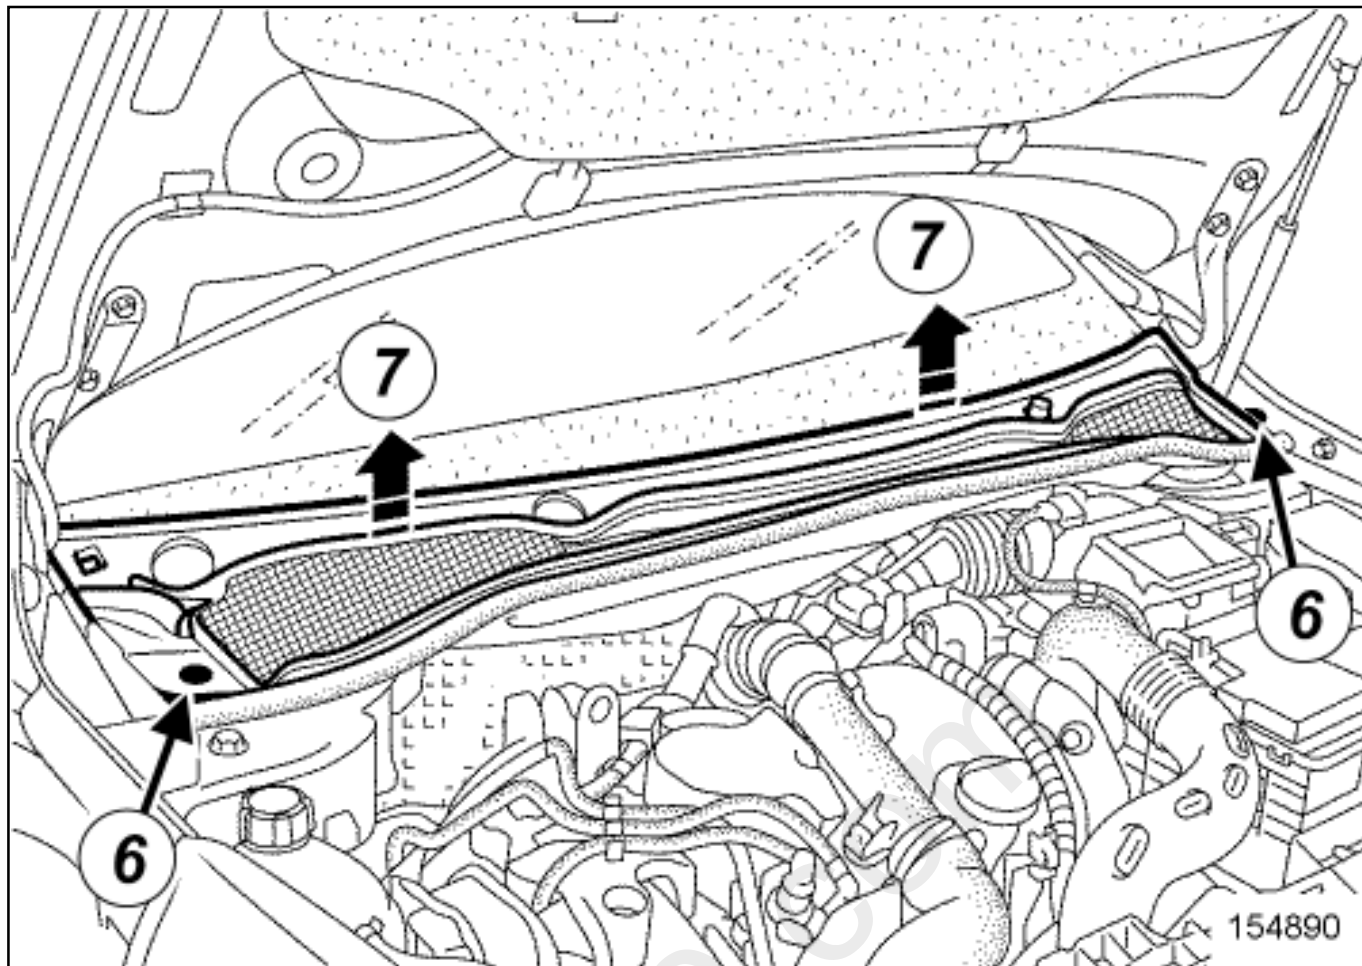

Remove the clips(6) from the scuttle panel grille.

Unclip the scuttle panel grille.

Remove the scuttle panel grille following the direction of the arrow(7) .

REFITTING

1. REFITTING PREPARATION OPERATION