



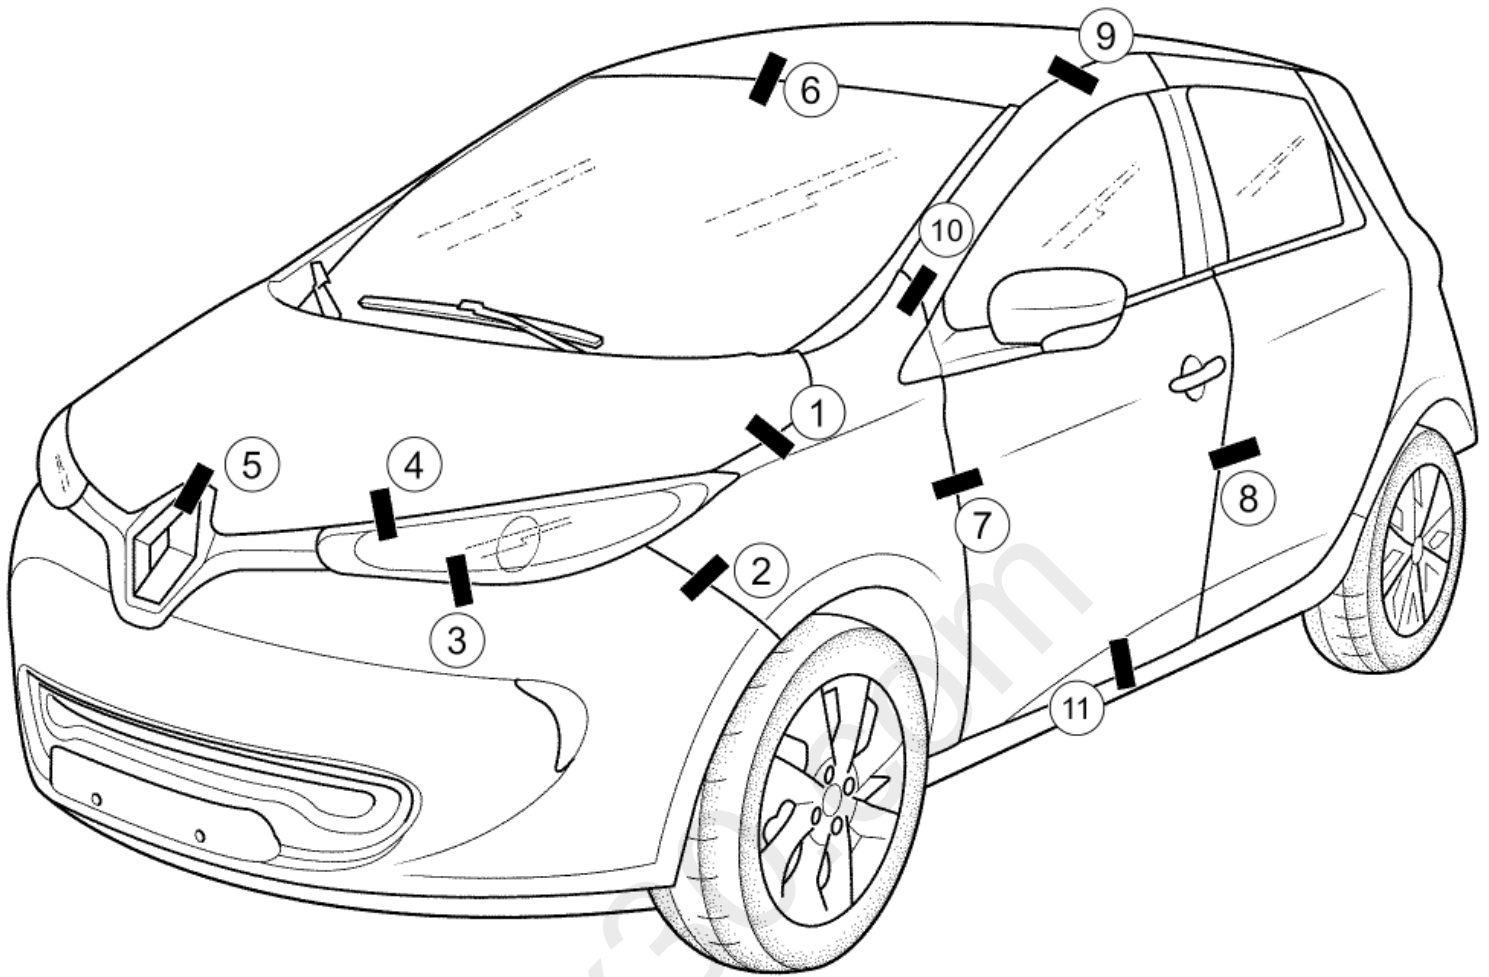

156199

No.	Location	Clearances (mm)
(1)	Front wing - bonnet	3.5 ± 1.5
(2)	Front bumper - front wing	0 ± 0.4
(3)	Headlight - front bumper	1.5 ± 1.1
(4)	Headlight - bonnet	3.5 ± 1.8
(5)	Bonnet - radiator grille	6.2 ± 1.7
(6)	Windscreen - roof panel	4 ± 1.5
(7)	Front wing - front side door	4 ± 1.3
(8)	Front side door - rear side door	4.5 ± 1.2
(9)	Door pillar - roof	7 ± 2
(10)	Front wing - windscreen pillar	4 ± 1.3
(11)	Front door - sill panel	4.5 ± 2

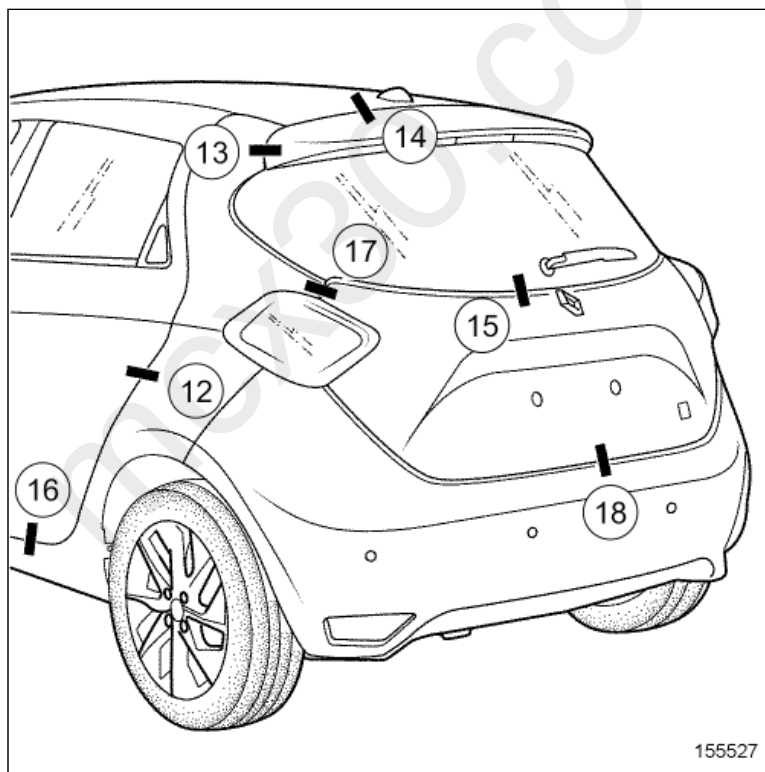

No.	Location	Clearances (mm)
(12)	Rear side door - body side	4 ± 1
(13)	Rear spoiler - body side	4 ± 1.9
(14)	Rear spoiler - roof	7 ± 1.9
(15)	Rear screen - tailgate	3 ± 1
(16)	Rear door -sill	4.5 ± 2
(17)	Body side - luggage compartment lid	4 ± 2
(18)	Luggage compartment lid - rear bumper	6 ± 2.2



Repair-00x01x01x05-02x13-1-30-1.xml



XSL version : 3.02 du 22/07/11

mcx30.com